Dealer Operation/ General Manager			Business Manager (F&I)	Service	Parts & Accessories	Administration
Date: November 2004 Bulletin # 13 004 04 (107)		Source: CTI 13 October 13, 2004 Name: Pat Raymond Title: Service and Technical Manager				



BMW Motorrad USA

Service Information Bulletin

Subject: Poor starting (when engine is cold); engine shuts off; poor engine

response when clutch is engaged after selecting a gear.

Models: 2005 model year F 650 CS, F 650 GS, F 650 Dakar.


Aftersales Solution:

Important note: This upgrade is to be completed only in cases of a customer complaint. Upgrade the BMS-C2 module software program from 170 to 180. Program release 180 has been used in F 650 series production from

June 4, 2004 (starting with the VIN's below).

Model	Starting VIN		
F 650 GS	ZL 40815		
F 650 GS Dakar	ZL 45268		
F 650 CS	ZM 50299		

Reprogram BMS-C2 module using GT1 program release 180.

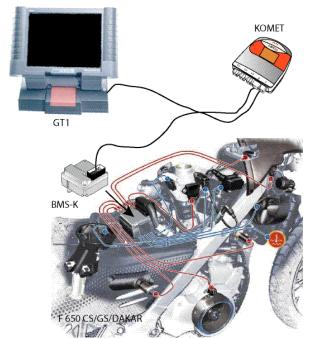

Warranty This update is covered under the terms of the New Motorcycle Limited **Information:** Warranty. Submit a regular warranty claim using the claim keys noted below:

Defect Code: 13 61 53 79 00

Description: BMS-wrong data version.

Flat Rate Code: 13 99 000 FRUs: 3 FRU

Contact: Respective Aftersales Business Consultant.